

# Technical Bulletin

Model  
All

Group  
4

Subject: Brake Vibration Damper Application

Part Identifier  
4745

Number  
9204

ATTENTION: Service Manager/Service Technician

This bulletin supersedes Technical Bulletin Group 4, Number 9108, Book H, pages 121-123.

**Models Affected:**

968 from Model Year '92 (N)  
944 S2, 944 turbo from Model Year '88 (J)  
911 Carrera 2 and 911 Carrera 4  
from Model Year '89 (K)  
911 turbo from Model Year '91 (M)  
928 S4, 928 GT from Model Year '88 (J)  
928 GTS

**Concern:**

Application of vibration dampers and damping plates.

**Vehicle Information:**

A new version damping plate with steel clip (formally plastic clip) is installed on 911 Carrera 2/4 rear axle from production date: April 2, 1991.

VIN: 96 \_ MS 41 1418 Coupe  
96 \_ MS 44 0719 Targa  
96 \_ MS 46 2026 Cabriolet

928 S4/GT rear axle from production date: April 12, 1991.

VIN: 92 \_ MS 81 0362

Use only new version damping plates when replacing damping plates on 911 C2/4 all Model Years and 928 S4/GT from Model Year '88 (J).

Refer to application chart for part numbers.

**Carrera 2 Only**

Rear brake calipers with shorter pistons were installed during production from VIN:

96 \_ LS 45 1922 up to 96 \_ LS 45 2002 Coupe  
96 \_ LS 46 0623 up to 96 \_ LS 46 0662 Targa  
96 \_ LS 47 1544 up to 96 \_ LS 47 1780 Cabriolet

When repairing cars for brake noise from rear brakes within the above VIN range, measure vibration damper length (see Figure 1). If old version 24mm long is installed, replace with new version 23mm long, Part Number 964 352 963 01. (Part Number 964 352 963 00 - 24mm long is no longer available.)

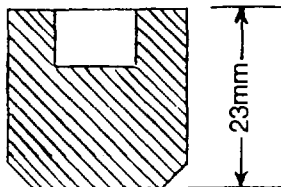


Figure 1

Index #: 027580



# Technical Bulletin

Model  
All

Group  
4

**Subject:** Brake Vibration Damper Application

Part Identifier  
4745

Number  
9204

## General Information:

1. Customer complaints of objectionable brake noise on certain vehicles require that the technician first inspect the vehicle for the existence of vibration dampers and damping plates.
2. When reinstalling /replacing brake pads, damping plates with adhesive surface must be replaced.

**Do not reuse damping plates with adhesive surface.**

3. When removing brake pads, use a small spatula to separate damping plates from brake pads. Do not damage caliper piston dust caps.

## Very Important:

Clean seating and guide surface of brake caliper with mineral spirits before installing vibration dampers and pads. Lubricants or grease must not be used in conjunction with vibration dampers. A light coat of sliding lubricant (Optimoly HT Part Number 000 043 004 00) may be applied on the guide surface of the pad carrier plate (Figure 2).

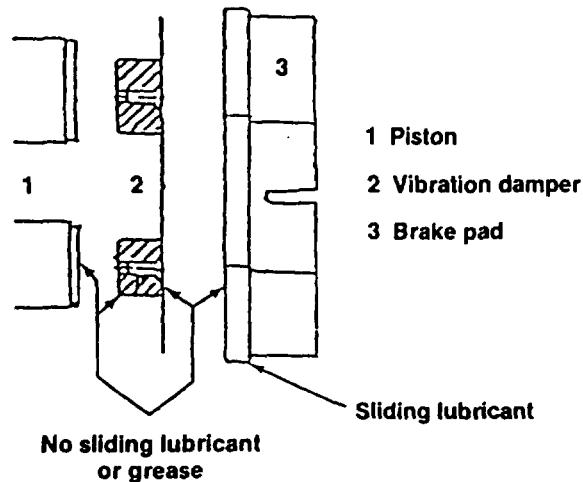


Figure 2



# Technical Bulletin

RECEIVED

Model  
All





Group  
4

Subject: Brake Vibration Damper Application

Part Identifier  
4745

Number  
9204

## Vibration damper and damping plate application chart

Front Axle	928 S4/GT	928 GTS	Carrera 2/4	911 turbo	944 S2	944 turbo	968
 <p>Ø 36 928 351 096 19 Ø 36 964 351 096 01 Ø 40 951 351 096 00 Ø 40 964 351 096 00 Ø 44 928 351 096 17 Ø 44 928 351 096 15 Ø 44 965 351 096 00</p> <p>Damping Plate</p>	<p>88-89<sup>1</sup> 89-<sup>3</sup></p> <p>92 -</p> <p>88-89<sup>1</sup> 89-<sup>3</sup></p> <p>92 -</p>	<p>89 -<sup>4</sup></p> <p>89 -<sup>4</sup></p> <p>92 -</p>	<p>89 -<sup>4</sup></p> <p>91 -</p> <p>91 -</p>	<p>91 -</p> <p>91 -</p>	<p>- 2/89<sup>2</sup> 2/89 - - 2/89<sup>2</sup> 2/89 -</p>	<p>-</p>	<p>-</p> <p>92 -</p> <p>92 -</p>
 <p>Vibration Damper</p> <p>951 351 089 00 951 351 089 03</p>	<p>88-89<sup>1,10</sup> 89-<sup>3,10</sup></p>				<p>90 -<sup>5</sup></p>	<p>88-89<sup>1</sup> 89 -<sup>6</sup></p>	<p>92 -<sup>5</sup></p>
<p>Rear Axle</p>  <p>Ø 28 928 352 096 11 Ø 28 964 352 096 01 Ø 30 928 352 096 10 Ø 30 964 352 096 00 Ø 34 965 352 096 01</p> <p>Damping Plate</p>	<p>88-89<sup>1</sup> 89-<sup>3</sup></p> <p>88-89<sup>1</sup> 89-<sup>3</sup></p>	<p>92 -</p> <p>92 -</p>	<p>89 -<sup>4</sup></p> <p>92 -<sup>8, 92<sup>9</sup></sup></p> <p>90-91</p>	<p>91 -</p> <p>91 -</p>	<p>89 -</p> <p>89 -</p>	<p>88-89<sup>1</sup> 89 -<sup>7</sup></p> <p>88-89<sup>1</sup> 89 -<sup>7</sup></p>	<p>92 -</p> <p>92 -</p>
 <p>Vibration Damper</p> <p>964 352 963 01</p>							

PORSCHE CARS NORTH AMERICA INC.



# Technical Bulletin

Model  
All

Group  
4

**Subject:** Brake Vibration Damper Application

Part Identifier  
4745

Number  
9204

**Note:** Ø = brake caliper piston diameter

- 1 Brake caliper with scraper rings
- 2 Brake caliper with scraper rings up to VIN: 94 \_ KN451880
- 3 Brake caliper with dust caps from VIN 92 \_ KS860282
- 4 911 Carrera 2 from M.Y. 90
- 5 944 S2, 968 with sport suspension (M030)
- 6 944 turbo and 944 turbo S: brake caliper with dust caps
- 7 Brake caliper with dust caps from VIN: 95 \_ KN150216
- 8 911 Carrera 4 only
- 9 911 Carrera 2 only
- 10 Install only on cars with brake noise

Install adhesive tape PNA 999 005 between vibration dampers and brake pads.

Clean vibration damper backing plate. Apply adhesive tape to backing plate and cut to size. Peel off protective paper after installing vibration damper in caliper.

For additional information, refer to Technical Bulletins, Book E, Group 4, Number 8810 and Book F, Group 4, Number 8907.

### Warranty Information (if applicable)

Damage Code	(with Parts)	Damage Code	(w/o Parts)
4636 20 0002	Front Pads	4636 20 0001	Front Pads
4638 20 0002	Rear Pads	4638 20 0001	Rear Pads

Labor Operations	TU	
R & R Front Brake Pads 4636 2003	80	944 /S /S2 /turbo,968, 911C2 /C4 /t
4636 2000	70	928 /S /S4 /GT /GTS
R & R Rear Brake Pads 4638 2000	70	928 /S /S4 /GT /GTS
4638 2003	80	968, 944 /S /S2 /t, 911C2 /C4 /t

**Important Notice:** Porsche Cars N.A. Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers.

©1992 Porsche Cars North America, Inc.

Dealership \_\_\_\_\_ Service manager \_\_\_\_\_ Shop foreman \_\_\_\_\_ Service technician \_\_\_\_\_  
 Distribution \_\_\_\_\_ Asst. manager \_\_\_\_\_ Warranty admin. \_\_\_\_\_ Service technician \_\_\_\_\_  
 Routing \_\_\_\_\_

The trademarks Porsche®, Targa®, Carrera®, Tiptronic® and the Porsche Crest are registered trademarks of Dr. Ing.h.c.F. Porsche AG and its affiliate, Porsche Cars North America, Inc.

©1992 Porsche Cars  
North America, Inc.  
All rights reserved. Cannot be  
reproduced without written permission.  
Porsche Technical Publications



# SERVICE

Page 4 of 4  
March 27, 1992

PORSCHE CARS NORTH AMERICA INC.